



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	280	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	14	Setup No:	3	Priority CCTV:	

House Number	7118	Street Prefix:		Street Name:	Park Heights	Street Type:	AVE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	2=Trace		
Sector:	2=Private	Drainage Area:	4				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 539

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0539.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 27
Setup No. 3
280(27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1115
Crew: T2	Street Location: Glenyle Ave		
US MH: 1521713	DS MH: 1522722	Number of Segments: 6	Test Length: 1655'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

S15 is a CB that had very very heavy smoke. The grate covering the CB can not be removed to access the storm line for lamping. 2 Lines & a drainage ditch flow to the CB.

Last Revised 9/16/2004

Sketch No:

280

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\280.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	280	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	Y
Defect No:	15	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:		
7120		Park Heights	AVE		
Source Type:	14= Catch Basin	Location:	7=Yard-Front	Severity:	4=Major
Sector:	1=Public	Drainage Area:	40000		
Comments:	south curb				

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 540

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0540.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 27
Setup No. 3
280(27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1115
Crew: T2	Street Location: Glenlyle Ave		
US MH: 1521713	DS MH: 1522722	Number of Segments: 6	Test Length: 1655'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

S15 is a CB that had very very heavy smoke. The grate covering the CB can not be removed to access the storm line for lamping. 2 Lines & a drainage ditch flow to the CB.

Last Revised 9/16/2004

Sketch No:

280

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\280.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	280	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	16	Setup No:	3	Priority CCTV:	

House Number	7126	Street Prefix:		Street Name:	Park Heights	Street Type:	AVE
Source Type:	06= Dwnspt Connect	Location:	9=Yard-Side	Severity:	4=Major		
Sector:	2=Private	Drainage Area:	1000				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 541

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0541.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 27
Setup No. 3
280(27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1115
Crew: T2	Street Location: Glenyle Ave		
US MH: 1521713	DS MH: 1522722	Number of Segments: 6	Test Length: 1655'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

S15 is a CB that had very very heavy smoke. The grate covering the CB can not be removed to access the storm line for lamping. 2 Lines & a drainage ditch flow to the CB.

Last Revised 9/16/2004 Leader Form

Sketch No:

280

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\280.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	280	Date:	10/13/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	2	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3617		Glengyle	AVE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major
Sector:	2=Private	Drainage Area:	0		
Comments:	8-a				

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 542

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0542.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 27
Setup No. 3
280(27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1115
Crew: T2	Street Location: Glenyle Ave		
US MH: 1521713	DS MH: 1522722	Number of Segments: 6	Test Length: 1655'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

315 is a CB that had very very heavy smoke. The grate covering the CB can not be removed to access the storm line for lamping. 2 Lines & a drainage ditch flow to the CB.

Last Revised 9/16/2004 Leader Form

Sketch No:

280

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\280.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	280	Date:	10/13/2004	MeterBasin:	01_WR32
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	3	Setup No:	3	Priority CCTV:	

House Number	3616	Street Prefix:		Street Name:	Glengyle	Street Type:	AVE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major		
Sector:	2=Private	Drainage Area:	0				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 528

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0528.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 27
Setup No. 3
280(27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1115
Crew: T2	Street Location: Glenyle Ave		
US MH: 1521713	DS MH: 1522722	Number of Segments: 6	Test Length: 1655'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

S/S is a CB that had very very heavy smoke. The grate covering the CB can not be removed to access the storm line for lapping. 2 Lines & a drainage ditch flow to the CB.

Last Revised 9/16/2004 Leader Form

Sketch No:

280

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\280.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	280	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	4	Setup No:	3	Priority CCTV:	

House Number	3608	Street Prefix:		Street Name:	Glengyle	Street Type:	AVE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	3=Moderate		
Sector:	2=Private	Drainage Area:	0				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 529

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0529.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 27
Setup No. 3
280(27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1115
Crew: T2	Street Location: Glenyle Ave		
US MH: 1521713	DS MH: 1522722	Number of Segments: 6	Test Length: 1655'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

315 is a CB that had very very heavy smoke. The grate covering the CB can not be removed to access the storm line for lamping. 2 Lines & a drainage ditch flow to the CB.

Last Revised 9/16/2004 Leader Form

Sketch No:

280

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\280.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	280	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	5	Setup No:	3	Priority CCTV:	

House Number	3606	Street Prefix:		Street Name:	Glengyle	Street Type:	AVE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major		
Sector:	2=Private	Drainage Area:	0				
Comments:							

SMOKE TEST PHOTOS

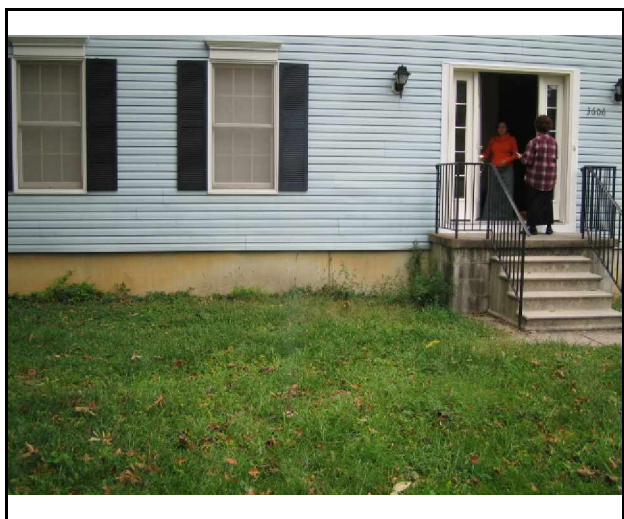


Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 530

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0530.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 27
Setup No. 3
280(27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1115
Crew: T2	Street Location: Glenyle Ave		
US MH: 1521713	DS MH: 1522722	Number of Segments: 6	Test Length: 1655'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

315 is a CB that had very very heavy smoke. The grate covering the CB can not be removed to access the storm line for lamping. 2 Lines & a drainage ditch flow to the CB.

Last Revised 9/16/2004 Leader Form

Sketch No:

280

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\280.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	280	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	6	Setup No:	3	Priority CCTV:	

House Number	3606	Street Prefix:		Street Name:	Glengyle	Street Type:	AVE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major		
Sector:	2=Private	Drainage Area:	0				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 531

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0531.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 27
Setup No. 3
280(27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1115
Crew: T2	Street Location: Glenyle Ave		
US MH: 1521713	DS MH: 1522722	Number of Segments: 6	Test Length: 1655'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

S15 is a CB that had very very heavy smoke. The grate covering the CB can not be removed to access the storm line for lamping. 2 Lines & a drainage ditch flow to the CB.

Last Revised 9/16/2004 Leader Form

Sketch No:

280

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\280.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	280	Date:	10/13/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	7	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
7014		Park Heights	AVE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major
Sector:	2=Private	Drainage Area:	4		

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 532

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0532.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.

SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM

Page 1 of 3
Smoke Set No. 27
Setup No. 3
280(27)

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1115
Crew: T2	Street Location: Glenyle Ave		
US MH: 1521713	DS MH: 1522722	Number of Segments: 6	Test Length: 1655'
Plugged US: Y (R)	Plugged DS: Y (N)	# of Blowers: 1 (2) 3	Ground: (Dry) Moderate Wet
Plugs Removed? Y (R)	Recorder: Bob Blunk	Comments: —	
FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)			

← Seven mile Lane →

Sketch No:

280

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\280.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	280	Date:	10/13/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	8	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
7012		Park Heights	AVE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major
Sector:	2=Private	Drainage Area:	0		

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 533

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0533.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 27
Setup No. 3
280(27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1115
Crew: T2	Street Location: Glenyle Ave		
US MH: 1521713	DS MH: 1522722	Number of Segments: 6	Test Length: 1655'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

315 is a CB that had very very heavy smoke. The grate covering the CB can not be removed to access the storm line for lamping. 2 Lines & a drainage ditch flow to the CB.

Last Revised 9/16/2004
Leader Form

Sketch No:

280

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\280.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	280	Date:	10/13/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	9	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
7012		Park Heights	AVE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major
Sector:	2=Private	Drainage Area:	50		

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 534

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0534.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 27
Setup No. 3
280(27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1115
Crew: T2	Street Location: Glenlyle Ave		
US MH: 1521713	DS MH: 1522722	Number of Segments: 6	Test Length: 1655'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

315 is a CB that had very very heavy smoke. The grate covering the CB can not be removed to access the storm line for lamping. 2 Lines & a drainage ditch flow to the CB.

Last Revised 9/16/2004 Leader Form

Sketch No:

280

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\280.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	281	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	1	Setup No:	4	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:		
7000		Park Heights	AVE		
Source Type:	18= Other	Location:	2=Paved Asphalt	Severity:	4=Major
Sector:	1=Public	Drainage Area:	4		
Comments:					

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 543

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0543.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 27
Setup No. 4
281 (27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1445
Crew: T2	Street Location: Olympia Ave	Number of Segments: 11	Test Length: 2180'
US MH: 1521877	DS MH: 1522034	# of Blowers: 1(2)3	Ground: Dry Moderate Wet
Plugged US: Y (N)	Plugged DS: Y (N)	Plugs Removed? Y (N)	Recorder: Bob Blank
Comments: CNF 1522214 + 1522213			

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

1521340 + 1521319 have storm manhole covers.

Last Revised 9/16/2004
Leader Form

Sketch No:

281

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\281.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	281	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	10	Setup No:	4	Priority CCTV:	

House Number	3502	Street Prefix:		Street Name:	Olympia	Street Type:	AVE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major		
Sector:	2=Private	Drainage Area:	0				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 552

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0552.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 27
Setup No. 4
281 (27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1445
Crew: T2	Street Location: Olympia Ave	Number of Segments: 11	Test Length: 2180'
US MH: 1521877	DS MH: 1522034	# of Blowers: 1(2)3	Ground: Dry Moderate Wet
Plugged US: Y (N)	Plugged DS: Y (N)	Plugs Removed? Y (N)	Recorder: Bob Blank
Comments: CNF 1522214 + 1522213			

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

1521340 + 1521319 have storm manhole covers.

Last Revised 9/16/2004
Leader Form

Sketch No:

281

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\281.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	281	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	2	Setup No:	4	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:		
7007		Park Heights	AVE		
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major
Sector:	2=Private	Drainage Area:	0		
Comments:					

SMOKE TEST PHOTOS



Photo No:
Filename Path:

Image Status: No image name specified.

Photo No: 544

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0544.JPG

Image Status: Image found and displayed.

Photo No:
Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 27
Setup No. 4
281 (27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1445
Crew: T2	Street Location: Olympia Ave	Number of Segments: 11	Test Length: 2180'
US MH: 1521877	DS MH: 1522034	# of Blowers: 1(2)3	Ground: (Dry) Moderate Wet
Plugged US: Y (N)	Plugged DS: Y (N)	Plugs Removed? Y (N)	Recorder: Bob Blank
Comments: CNF 1522214 + 1522213			

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

1521340 + 1521319 have storm manhole covers.

Last Revised 9/16/2004
Leader Form

Sketch No:

281

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\281.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	281	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	3	Setup No:	4	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:		
7007		Park Heights	AVE		
Source Type:	02= Service Line	Location:	7=Yard-Front	Severity:	2=Trace
Sector:	2=Private	Drainage Area:	16		
Comments:					

SMOKE TEST PHOTOS

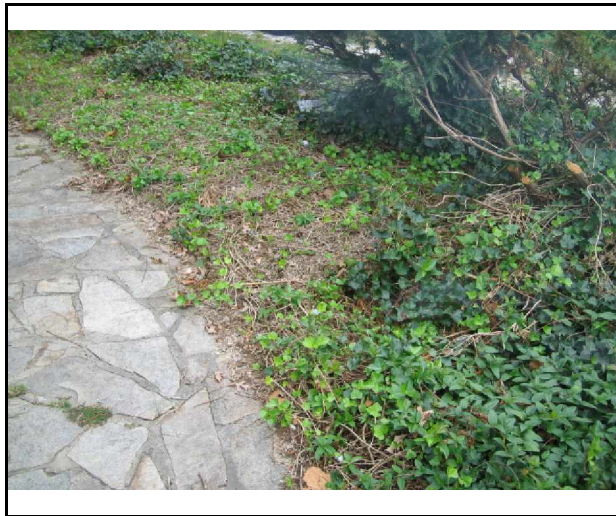


Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 545

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0545.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 27
Setup No. 4
281 (27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1445
Crew: T2	Street Location: Olympia Ave	Number of Segments: 11	Test Length: 2180'
US MH: 1521877	DS MH: 1522034	# of Blowers: 1(2)3	Ground: Dry Moderate Wet
Plugged US: Y (N)	Plugged DS: Y (N)	Plugs Removed? Y (N)	Recorder: Bob Blank
Comments: CNF 1522214 + 1522213			

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

1521340 + 1521319 have storm manhole covers.

Last Revised 9/16/2004
Leader Form

Sketch No:

281

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\281.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	281	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	4	Setup No:	4	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:		
7005		Park Heights	AVE		
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	4=Major
Sector:	2=Private	Drainage Area:	0		
Comments:					

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 546

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0546.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 27
Setup No. 4
281 (27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1445
Crew: T2	Street Location: Olympia Ave	Number of Segments: 11	Test Length: 2180'
US MH: 1521877	DS MH: 1522034	# of Blowers: 1(2)3	Ground: Dry Moderate Wet
Plugged US: Y (N)	Plugged DS: Y (N)	Plugs Removed? Y (N)	Recorder: Bob Blank
Comments: CNF 1522214 + 1522213			

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

1521340 + 1521319 have storm manhole covers.

Last Revised 9/16/2004
Leader Form

Sketch No:

281

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\281.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	281	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	Y
Defect No:	5	Setup No:	4	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:		
7001		Park Heights	AVE		
Source Type:	14= Catch Basin	Location:	6=Curb	Severity:	3=Moderate
Sector:	1=Public	Drainage Area:	30000		
Comments:	north corner				

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 547

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0547.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 27
Setup No. 4
281 (27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1445
Crew: T2	Street Location: Olympia Ave	Number of Segments: 11	Test Length: 2180'
US MH: 1521877	DS MH: 1522034	# of Blowers: 1(2)3	Ground: Dry Moderate Wet
Plugged US: Y (N)	Plugged DS: Y (N)	Plugs Removed? Y (N)	Recorder: Bob Blank
Comments: CNF 1522214 + 1522213			

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

1521340 + 1521319 have storm manhole covers.

Last Revised 9/16/2004
Leader Form

Sketch No:

281

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\281.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	281	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	6	Setup No:	4	Priority CCTV:	

House Number	6911	Street Prefix:		Street Name:	Park Heights	Street Type:	AVE
Source Type:	02= Service Line	Location:	7=Yard-Front	Severity:	2=Trace		
Sector:	2=Private	Drainage Area:	16				
Comments:							

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 548

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0548.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 27
Setup No. 4
281 (27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1445
Crew: T2	Street Location: Olympia Ave	Number of Segments: 11	Test Length: 2180'
US MH: 1521877	DS MH: 1522034	# of Blowers: 1(2)3	Ground: (Dry) Moderate Wet
Plugged US: Y (N)	Plugged DS: Y (N)	Plugs Removed? Y (N)	Recorder: Bob Blank
Comments: CNF 1522214 + 1522213			

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

1521340 + 1521319 have storm manhole covers.

Last Revised 9/16/2004
Leader Form

Sketch No:

281

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\281.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	281	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	7	Setup No:	4	Priority CCTV:	

House Number	6905	Street Prefix:		Street Name:	Park Heights	Street Type:	AVE
Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:	2=Trace		
Sector:	2=Private	Drainage Area:	0				
Comments:							

SMOKE TEST PHOTOS

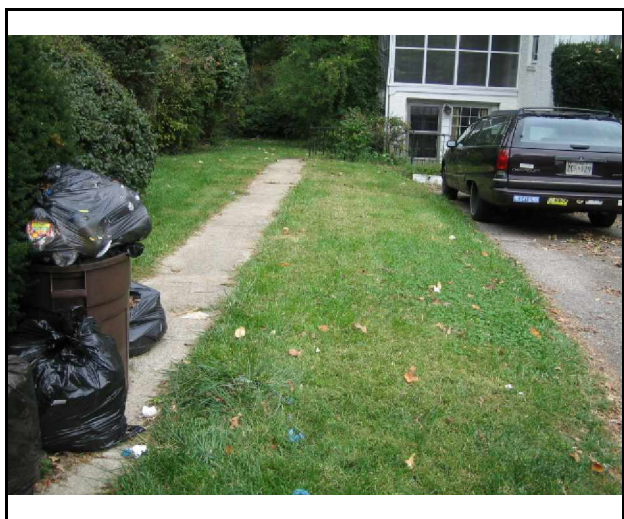


Photo No:
Filename Path:

Image Status: No image name specified.

Photo No: 549

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0549.JPG

Image Status: Image found and displayed.

Photo No:
Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 27
Setup No. 4
281 (27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1445
Crew: T2	Street Location: Olympia Ave	Number of Segments: 11	Test Length: 2180'
US MH: 1521877	DS MH: 1522034	# of Blowers: 1(2)3	Ground: (Dry) Moderate Wet
Plugged US: Y (N)	Plugged DS: Y (N)	Plugs Removed? Y (N)	Recorder: Bob Blank
Comments: CNF 1522214 + 1522213			

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

1521340 + 1521319 have storm manhole covers.

Last Revised 9/16/2004
Leader Form

Sketch No:

281

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\281.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	281	Date:	10/13/2004	MeterBasin:	01_WR29
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	8	Setup No:	4	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:		
7001		Park Heights	AVE		
Source Type:	02= Service Line	Location:	9=Yard-Side	Severity:	3=Moderate
Sector:	2=Private	Drainage Area:	18		
Comments:					

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 550

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-2\PLAYER_B\B_2004_1013Image0550.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 27
Setup No. 4
281 (27)

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/13/04	Start Time: 1445
Crew: T2	Street Location: Olympia Ave	Number of Segments: 11	Test Length: 2180'
US MH: 1521877	DS MH: 1522034	# of Blowers: 1(2)3	Ground: Dry Moderate Wet
Plugged US: Y (N)	Plugged DS: Y (N)	Plugs Removed? Y (N)	Recorder: Bob Blank
Comments: CNF 1522214 + 1522213			

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

1521340 + 1521319 have storm manhole covers.

Last Revised 9/16/2004
Leader Form

Sketch No:

281

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\281.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.